


**Qualimax Flooring - TIMBER PLANK SERIES - Multiple Colours - Wet Sliptest  
SN140920-13**

14 Sep 2020


**Slip Resistance Classification of New Pedestrian Surfaces - AS4586:2013 Appendix A**

Date Tested:	14 Sep 2020
Test Report Number:	SN140920-13
Client Name & Address:	Qualimax Flooring - 5/36 South St, Rydalmere NSW 2116
Test Site / Surface Tested :	TIMBER PLANK SERIES - Multiple Colours
Sample Information :	Samples and Test Information Supplied by Client
Wet Pendulum Test carried out using :	Slider 96 (4S) Rubber slider
Testing Officer :	Shenea Neill
Testing Officer :	#1133 - 31.10.2019 - Munro-Stanley Portable Skid Tester

Testing Officer Signatory:

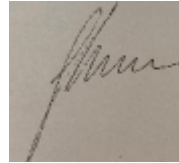

**Test Results :**

Sample No.	Swing 1	Swing 2	Swing 3	Swing 4	Swing 5	Mean BPN of last 3 swings :	Surface Picture
Red Iron Bark	15	15	15	15	15	15	
Grey Iron Bark	23	21	20	20	20	20	

Sample No.	Swing 1	Swing 2	Swing 3	Swing 4	Swing 5	Mean BPN of last 3 swings :	Surface Picture
Spotted Gum	16	16	16	16	16	16	
Pacific Black Butt	30	27	27	26	26	26	
Black Butt	15	15	15	15	15	15	

Mean BPN Slip Resistance Value (SRV)

18

CLASSIFICATION using Slider 96 (4S Slider)

P1 = 12 - 24

*Accredited for Compliance with ISO/IEC 17025. The information presented herein and on the Sliptest Report is copyright and is protected by copyright law, any reproduction of this information and test report except in full is prohibited. Sliptest Australia Pty. Ltd. performed this on site test with reference to the following Australian Standard testing criteria, of AS 4586:2013 Classification of new pedestrian surface materials. Appendix A – Wet Pendulum Test Method and Hand Book HB 198: 2014 with reference to AS/NZS 4663: 2004 Slip Resistance measurement of existing pedestrian surfaces and HB 197: 1999. These results do not account for Future Wear, Maintenance or Contamination of this surface once in-situ.*

Page 1 of 1 - END OF REPORT